CODE LETTER	SUITABILITY CODE DESCRIPTION
A	Soil series should have ability to function as suitable absorption field with proper design, installation, and maintenance
B	Some rock and or stony conditions were found. This soil should function as a suitable absorption field providing that the system is put in first to make sure there will be no rock limiting. Holes have been bored at least 72" deep within this unit with a hand auger.
C	Due to water table, flooding, and or drainage problems, there is a HIGH PROBILITY OF FAILURE for conventional systems. (Your Health Department can discuss with you if an alternate system might be an option for your situation.)
F	Normally considered unsatisfactory for use for conventional absorption fields.

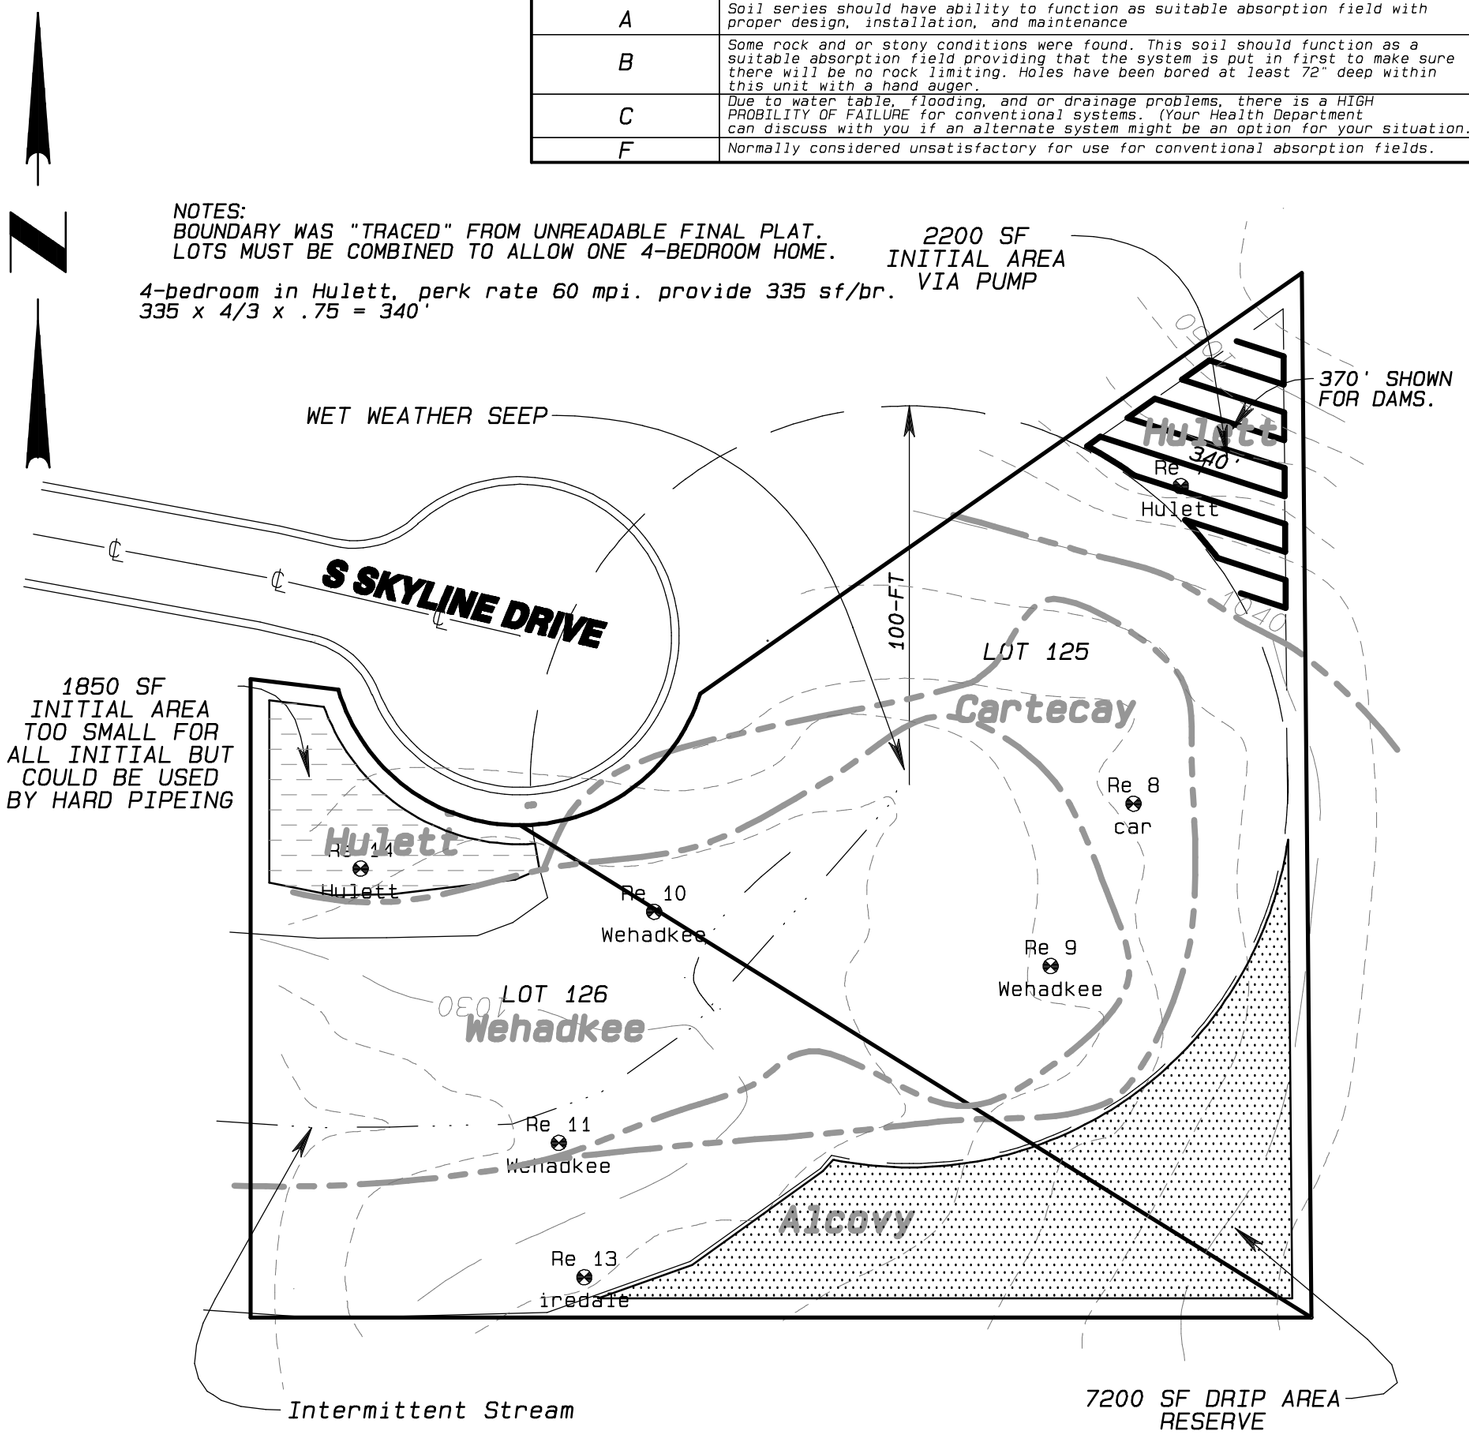

SOIL TYPE	Slope %	Water inches	Resistance inches	Code	Trench Depth inches	Perk Rate min/in	Infil. Rate gal/sf/day
Alcovy	3 - 8	a30	>72	C	8 - 18	65	0.10
Cartecay	2 - 6	6	nsd	F	See Code	See Code	See Code
Hulett	2 - 8	>60	>72	A	18 - 36*	60	0.15
Wehadkee	2 - 6	<3	nsd	F	See Code	See Code	See Code

p = perched water table, a = apparent water table nsd = Not Sufficent Data

GRAPHIC SCALE 1"=40'

0 40 80 120

LEVEL III SOILS STUDY

LOTs 125 & 126, MONTAGE MANOR S/D (6150 AND 6166 S SKYLINE DR)
LL 67, DISTRICT 25, DOUGLAS COUNTY, GEORGIA

DATE: JUNE 27, 2024
REV: JULY 1, 2024
REV: AUGUST 1, 2024
REV: AUGUST 19, 2024
REV: SEPTEMBER 30, 2024

FOR
Troy Winslett
5090 River Lake Drive
Fairburn, Ga 30213-1800
678 656 9792

GEORGIA REGISTERED No. 012170 PROFESSIONAL ENGINEER LARRY F. MCEVER

RESOURCE ENGINEERS INCORPORATED
8305 SPENCE ROAD
FAIRBURN, GEORGIA 30213
770 969 8923
EMAIL: RESO_ENG@COMCAST.NET

Job No. 4746